UKDP
24 Stonelaw Road,, Rutherglen
Tel. 016280788600
info@ukdpsolutions.co.uk

Section Inspection - 20/01/2025 - MH1X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
1	1	20/01/25	0:00	INS7068	Dry	0	MH1X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Downstream	**Upstream Node:**	MH1
Road:		**Inspected Length:**	5.89 m	**Upstream Pipe Depth:**	0.500 m
Location:		**Total Length:**	5.89 m	**Downstream Node:**	MH2
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Pipe Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining:**	No Lining
Inspection Purpose:		**Lining Material:**	

Comments:
Recommendations:

Scale: 1:51

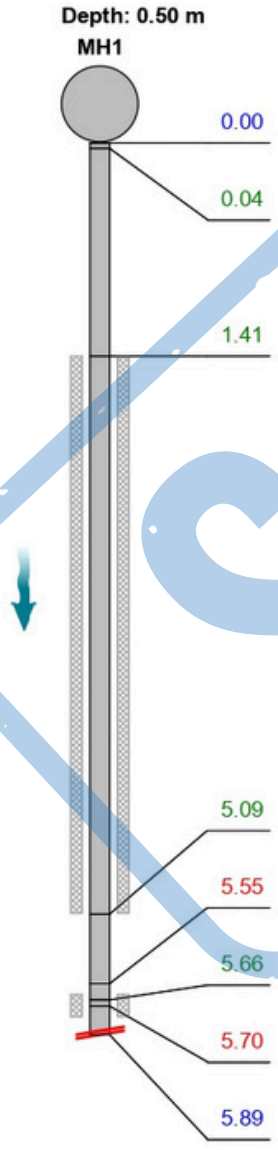

Position [m]	Code		Observation	MPEG	Photo	Grade
0.00		ST	Start of survey	00:00:00	MH1X_cb29c6ac-d7e1-4b53-bf7	
0.04		LR	Line of sewer deviates right	00:00:01	MH1X_b8dcafda-5f8a-4f10-9be	
1.41	S01	DEG	Debris, grease from 11 o'clock to 1 o'clock, 10% cross-sectional area loss, start	00:00:15	MH1X_56058701-330a-4e09-9	3
5.09	C01	DEG	Debris, grease from 11 o'clock to 1 o'clock, 5% cross-sectional area loss, change	00:00:28	MH1X_c3427ae5-0be0-45a8-a0	
5.55		D	Deformed sewer, 15% of original diameter/height: From 6 to 12 O'clock	00:00:30	MH1X_7896ce19-51e1-4bd7-9f	3
5.66		WL	Water level, 10% of sewer height	00:00:32		
5.70	S02	D	Deformed sewer, 15% of original diameter/height, start: 12 O'clock	00:00:32	MH1X_72b9f780-b977-4ce6-a	3
5.89		SA	Survey abandoned: Unable to push camera	00:00:51	MH1X_10093812-9238-453a-9	


Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	**STR Peak**	**STR Mean**	**STR Total**	**STR Grade**	**SER No. Def**	**SER Peak**	**SER Mean**	**SER Total**	**SER Grade**
2	40.0	13.6	80.0	3.0	1	0.0	0.3	2.0	1.0

SAMPLE


UKDP
24 Stonelaw Road,, Rutherglen
Tel. 016280788600
info@ukdpsolutions.co.uk

Section Pictures - 20/01/2025 - MH1X


Item No.	Inspection Direction	PLR	Client`s Job Ref	Contractor`s Job Ref
1	Downstream	MH1X	INS7068	

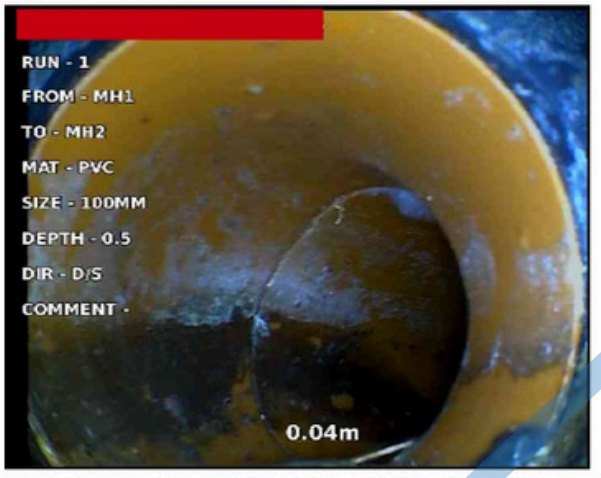


MH1X_cb29c6ac-d7e1-4b53-bf72-bab27975cc62_20250120_133304_317.jpg, 00:00:00, 0.00 m
Start of survey

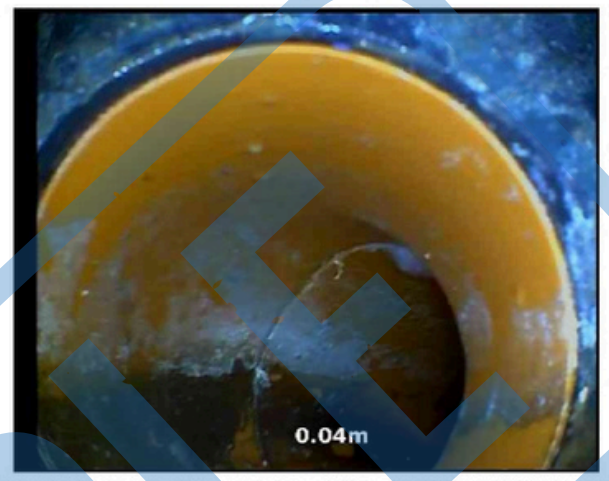

MH1X_b8dcafda-5f8a-4f10-9bec-bf7dca9b7672_20250120_133350_587.jpg, 00:00:01, 0.04 m
Line of sewer deviates right

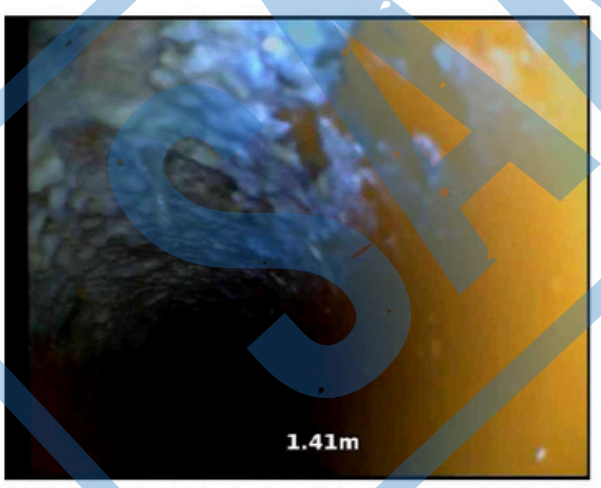

MH1X_56058701-330a-4e09-9a0f-4ca356bca2fe_20250120_133433_013.jpg, 00:00:15, 1.41 m
Debris, grease from 11 o'clock to 1 o'clock, 10% cross-sectional area loss, start

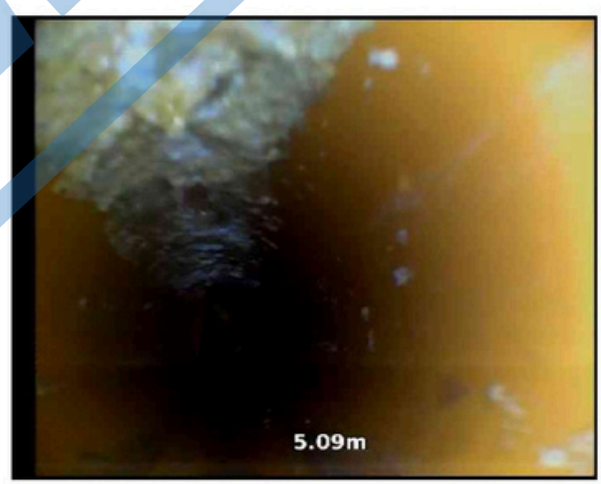


MH1X_c3427ae5-0be0-45a8-a0ab-e60ed2c62379_20250120_133507_718.jpg, 00:00:28, 5.09 m
Debris, grease from 11 o'clock to 1 o'clock, 5% cross-sectional area loss, change

SAMPLE


UKDP
24 Stonelaw Road,, Rutherglen
Tel. 016280788600
info@ukdpsolutions.co.uk

Section Pictures - 20/01/2025 - MH1X


Item No.	Inspection Direction	PLR	Client`s Job Ref	Contractor`s Job Ref
1	Downstream	MH1X	INS7068	

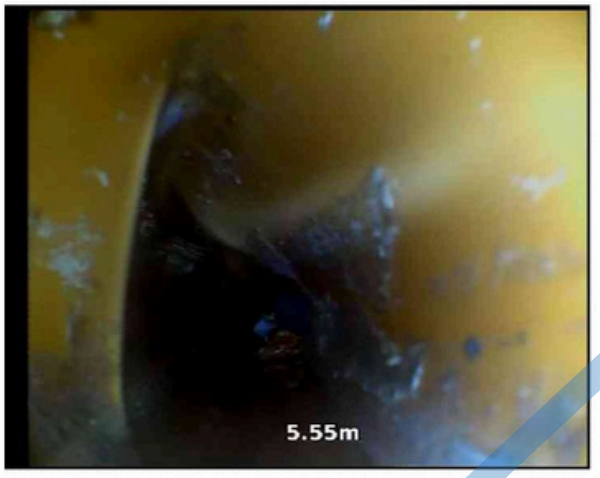

MH1X_7896ce19-51e1-4bd7-9fb7-358c01b626eb_20250120_133553_482.jpg, 00:00:30, 5.55 m
Deformed sewer, 15% of original diameter/height, From 6 to 12 O'clock

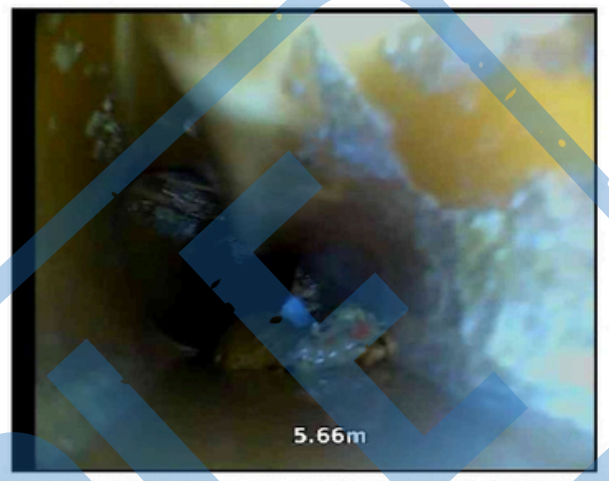

MH1X_72b9f780-b977-4ce6-aac6-30e32f2909a7_20250120_133632_377.jpg, 00:00:32, 5.70 m
Deformed sewer, 15% of original diameter/height, start, 12 O'clock

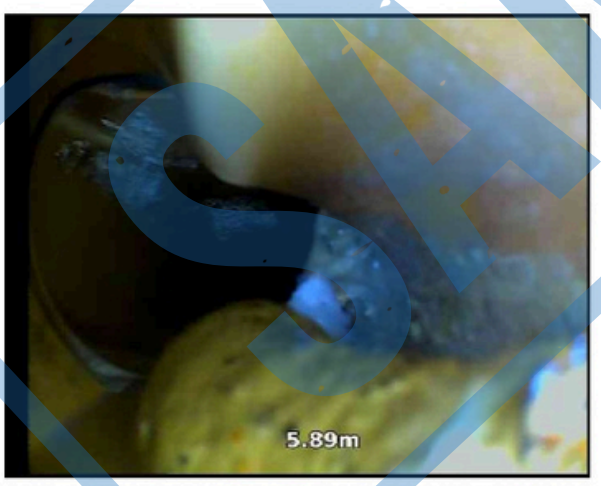

MH1X_10093812-9238-453a-99a7-651d7dc8d95c_20250120_133800_238.jpg, 00:00:51, 5.89 m
Survey abandoned, Unable to push camera

SAMPLE

UKDP
24 Stonelaw Road,, Rutherglen
Tel. 016280788600
info@ukdpsolutions.co.uk

Section Inspection - 20/01/2025 - MH1X

Item No.	Insp. No.	Date	Time	Client`s Job Ref	Weather	Pre Cleaned	PLR
2	1	20/01/25	0:00	INS7068	Dry	0	MH1X


Operator	Vehicle	Camera	Preset Length	Legal Status	Alternative ID
Not Specified	Not Specified	Not Specified	Not Specified	Not Specified	Not Specified

Town or Village:		**Inspection Direction:**	Upstream	**Upstream Node:**	MH1
Road:		**Inspected Length:**	0.76 m	**Upstream Pipe Depth:**	0.500 m
Location:		**Total Length:**	0.76 m	**Downstream Node:**	MH2
Surface Type:		**Joint Length:**		**Downstream Pipe Depth:**	1.300 m

Use:	Foul	**Pipe Shape:**	Circular
Type of Pipe:		**Dia/Height:**	100 mm
Flow Control:		**Pipe Material:**	Polyvinyl chloride
Year Constructed:	Not Specified	**Lining:**	No Lining
Inspection Purpose:		**Lining Material:**	

Comments:
Recommendations:

Scale: 1:50

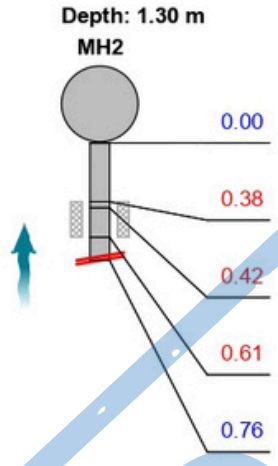

Position [m]	Code		Observation	MPEG	Photo	Grade
0.00		ST	Start of survey	00:00:00	MH1X_b53e8da0-8edf-416d-ad	
0.38	S01	D	Deformed sewer, 10% of original diameter/height, start: at 10 O'clock	00:00:08	MH1X_2aef634b-99ce-4329-8	2
0.42	C01	D	Deformed sewer, 20% of original diameter/height, change: at 10 O'clock	00:00:08	MH1X_31cd0bca-9743-4b55-bd	
0.61	C01	D	Deformed sewer, 20% of original diameter/height, change: From 8 to 12 O'clock	00:00:09	MH1X_0ead1eea-6abd-4097-b	
0.76		SA	Survey abandoned: Unable to push camera past	00:00:11	MH1X_a2c45cb7-d2ab-4a43-b4	


Construction Features					Miscellaneous Features				
Structural Defects					Service & Operational Observations				
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
1	0.0	26.3	20.0	2.0	0	0.0	0.0	0.0	1.0

SAMPLE


UKDP
24 Stonelaw Road,, Rutherglen
Tel. 016280788600
info@ukdpsolutions.co.uk

Section Pictures - 20/01/2025 - MH1X


Item No.	Inspection Direction	PLR	Client`s Job Ref	Contractor`s Job Ref
2	Upstream	MH1X	INS7068	

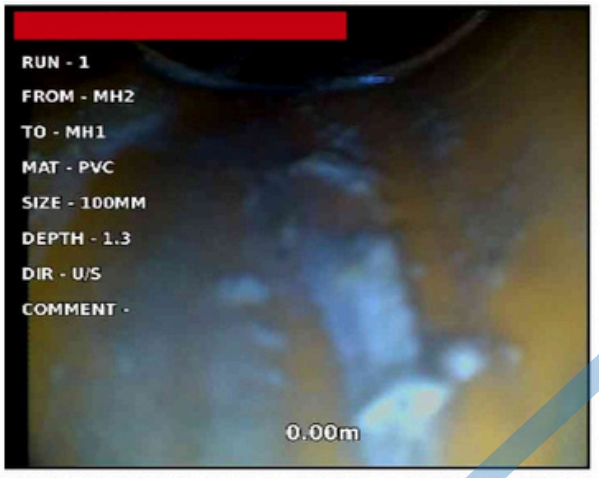


MH1X_b53e8da0-8edf-416d-adb7-521aec5a8525_20250120_133913_873.jpg, 00:00:00, 0.00 m
Start of survey

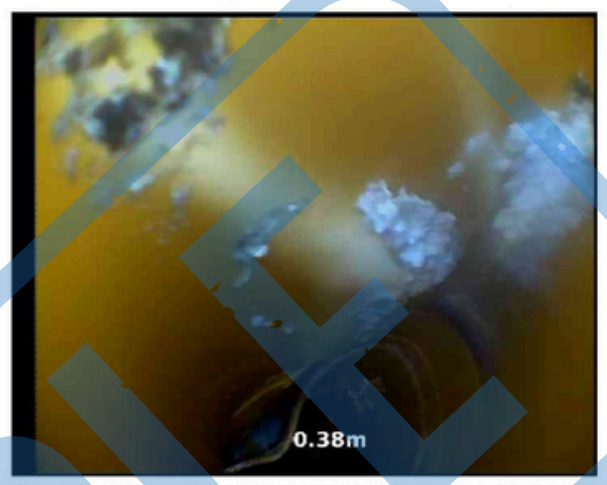

MH1X_2aef634b-99ce-4329-8ae6-b0b68861c6e4_20250120_134027_186.jpg, 00:00:08, 0.38 m
Deformed sewer, 10% of original diameter/height, start, at 10 O'clock

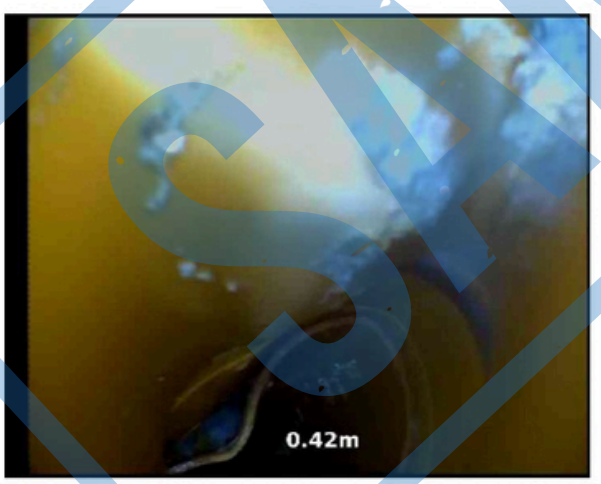

MH1X_31cd0bca-9743-4b55-bd9b-c455b6255c9d_20250120_134102_101.jpg, 00:00:08, 0.42 m
Deformed sewer, 20% of original diameter/height, change, at 10 O'clock

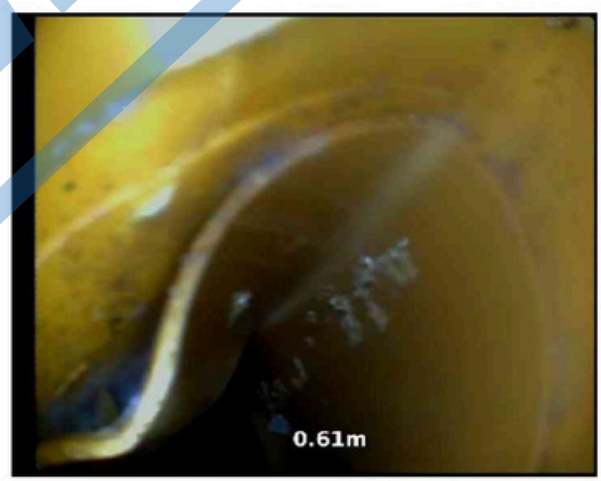


MH1X_0ead1eea-6abd-4097-b27f-b7b020615ea3_20250120_134214_214.jpg, 00:00:09, 0.61 m
Deformed sewer, 20% of original diameter/height, change, From 8 to 12 O'clock

SAMPLE

UKDP
24 Stonelaw Road,, Rutherglen
Tel. 016280788600
info@ukdpsolutions.co.uk

Section Pictures - 20/01/2025 - MH1X

Item No.	Inspection Direction	PLR	Client`s Job Ref	Contractor`s Job Ref
2	Upstream	MH1X	INS7068	

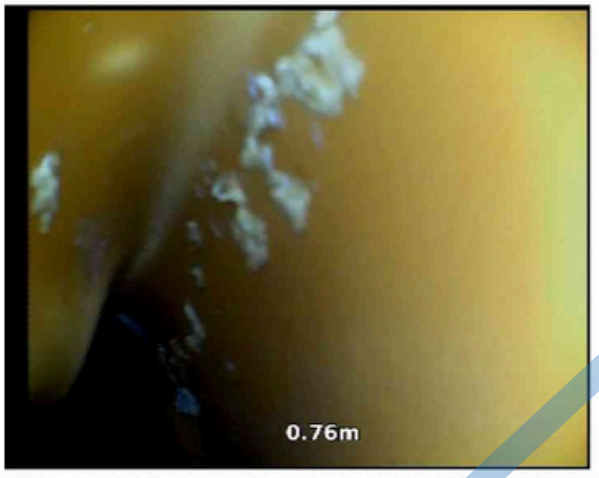

MH1X_a2c45cb7-d2ab-4a43-b42d-48ccef41a087_20250120_134255_553.jpg, 00:00:11, 0.76 m
Survey abandoned, Unable to push camera past

SAMPLE